



Notification of Demolition

Case #: 24-121

Amendment: 0

11815 NE 99th Street, Suite 1294
Vancouver, WA 98662
Voice: 360-574-3058
Fax: 360-576-0925
Web: <https://www.swcleanair.gov>
Email: Tina@swcleanair.gov

Date Received: 2/27/2024

Date Paid: 2/27/2024

SWCAA Fee: \$74.00

Receipt #: 151875421

10 day waiting period from date submitted

1. Type of Notification: Original

2. Type of Operation: Demolition

3. Facility Description: 4717 NE 372ND ST.

Commercial Name or Description: Double wide mobile home

Address: 4717 NE 372ND ST.

City/State/Zip/County: La Center, WA 98629 CLARK COUNTY

Present Use: Vacant

Previous Use: Residence

4. Facility Information

Property Owner: Paul Muirhead / Pia Rivera-Muirhead

Mailing Address:

Contact:

Phone:

5. Name and AHERA Certification Number of Asbestos Inspector:

Name: Kyler Spears

Certification #: 187341

6. Asbestos Removal Contractor (if applicable):

Name:

Mailing Address: WA,

Contact:

Phone:

7. Dates Asbestos Removal Occurred:

Start:

Complete:

Asbestos Case No.: -

8. Dates Demolition Will Occur:

Start: 3/8/2024

Complete: 4/8/2024

9. Demolition Contractor:

Name: JB Stump Grinding

Mailing Address: 42107 NE Goodnight Rd, La Center, WA, 98629

Contact:

Phone:

10. Asbestos Disposal Site: N/A

11. Description of planned demolition work, method(s) to be used:

All personal belongings have been removed. Appliances have been removed and taken to Waste Connections transfer station (fridge, dishwasher, Window AC units (2 each). Remove and recycle (hot water heater, electric furnace, Wood

12. Fugitive Emissions/dust from Demolition Activities MUST BE Controlled/Prevented during all phases of the project

Water mist to prevent dust as needed

13. If unexpected Asbestos containing Material (ACM) is found during demolition, Stop Work, Notify SWCAA and Consult/Hire a Certified Asbestos Abatement Contractor

N/A

14. If demolition is ordered by a Government Agent:

Name:
Agency:
Date of Order:

Title:
Date Ordered to Begin:

15. For Emergency Demolitions (Contact SWCAA prior to work): ☐ **Emergency Demolition**

Date and Time of Emergency:

Description of Sudden, Unexpected Event:

Explanation of how the event caused unsafe conditions or would cause equipment damage or an unreasonable burden:

16. I Certify that the above information is correct:

Submitter Name: Paul Muirhead

Representing: Paul Muirhead

Submitter Title: Owner

Date Submitted: 2/27/2024

Email Address: pemuirhead@gmail.com

Reviewed by SWCAA: Brian Fallon

☒ **Approved**

The Washington State Dangerous Waste Regulations (WAC 173-303) require that demolition debris be evaluated to determine if it is dangerous. The evaluation should be completed before demolition to ensure that hazardous constituents are not released to the environment and do not present a risk to human health during or after demolition. These requirements apply to all buildings being demolished and are the responsibility of the property owner. The Washington Department of Ecology's website, <https://ecology.was.gov/Regulations-Permits/Guidance-technical-assistance/Dangerous-waste-guidance/Common-dangerous-waste/Construction-and-demolition>, provides more information about the requirements and about sampling and testing construction materials to determine if they present a risk. For more information please contact a Hazardous Waste Inspector at the Washington Department of Ecology Southwest Regional Office: (360) 407-6300.

ASBESTOS SURVEY

For the mobile home located at:

**4717 NE 372ND STREET
LA CENTER, WASHINGTON**

Prepared for:
Mr. Paul Muirhead

**CERTIFIED ENVIRONMENTAL CONSULTING, LLC
615 SE CHKALOV DRIVE SUITE 12
VANCOUVER, WASHINGTON 98683-5280**

Prepared by:
Don Young
Kyler Spears
Eric S. Viken

EXECUTIVE SUMMARY

Dear Mr. Muirhead:

Enclosed are the results of the asbestos survey report conducted by C.E.C., LLC, for the mobile home located at, 4717 NE 372nd Street, in La Center, Washington for demolition purposes. This survey was coordinated with you and conducted on November 17, 2023, by Kyler Spears, Don Young, and Eric S. Viken, AHERA certified inspectors.

All samples were taken in a random manner as required by EPA AHERA rules and analyzed using polarized light microscopy with dispersion staining according to EPA and OR-OSHA Methodology. The samples were analyzed in C.E.C., LLC's laboratory at, 615 SE Chkalov Drive Suite #12, in Vancouver, Washington. As the asbestos samples were analyzed in our laboratory, the analytical data enclosed is the analysis report.

Asbestos was not identified in this location (See sample data sheet attached). Please note: the quantities and/or amounts listed within (Summary Data, Assessment of Materials sections) are estimates only and are not to be relied upon for estimating the removal costs. All quantities and/or amounts should be field verified by the responsible parties for the true amounts and removal costs.

The following survey is divided into the following sections:


- ◇ Summary sheet - details the type and construction of the building with approximate amounts of asbestos in the building.
- ◇ Sample result sheet - contains sample numbers and results, description of materials and homogeneous areas of material.
- ◇ Assessment of materials - contains an assessment of asbestos materials.
- ◇ Response actions recommended - contains the response actions we recommend.
- ◇ Laboratory analysis sheet - contains the results of our laboratory analysis.
- ◇ Inspector's certifications.
- ◇ Photographic log.
- ◇ Asbestos chain of custody form (survey report form).

C.E.C. has investigated accessible and inaccessible areas of this facility in locating suspect ACM using destructive sampling including the interior and exterior. The current extent and condition of the ACM was detected through on-site observation and physical determination.

NOTE: This asbestos survey report is available to Mr. Paul Muirhead, and not to be reproduced in total or part without written consent of Mr. Paul Muirhead.

We appreciate the opportunity to have worked with you. If you have any questions or if we can be of any further service, please contact our office.

Sincerely,

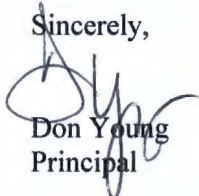

Don Young
Principal

SUMMARY SHEET

Owner or Representative: Paul Muirhead

Address: Mobile Home at, 4717 NE 372nd Street

City: La Center **State:** Washington

Owner's Representative:

Mr. Paul Muirhead
PO Box 530
La Center, Washington 98629

Owner/Rep. Telephone Number: (442) 317-1990

Surveyed by: Kyler Spears-Accreditation Number: 187341
Don Young-Accreditation Number: 190124
Eric S. Viken-Accreditation Number: 187343

CONSTRUCTION DATA:

Year Built: Approx.: 1989

Size: Approx. 1,200 SQ FT

Construction Type: Wood, Metal

Number of Floors: 1

Current/Past Use: Residential/Residential

Roof Construction: Asphalt Shingle

Heating System: Furnace

Attic Insulation: Fiberglass

Pipe Insulation: Non-Insulated

SUMMARY DATA**MOBILE HOME AT, 4717 NE 372ND STREET, LA CENTER, WASHINGTON**

PRODUCT	FUNCTIONAL SPACE	AMOUNT	FRIABLE	CONDITION	SAMPLE #	RESULTS
ASBESTOS WAS NOT IDENTIFIED IN THIS LOCATION						

Please note: the quantities and/or amounts listed within (Summary Data, Assessment of Materials sections) are estimates only and are not to be relied upon for estimating the removal costs. All quantities and/or amounts should be field verified by the responsible parties for the true amounts and removal costs.

Certified Environmental Consulting, LLC, warrants that the findings contained herein have been prepared in general accordance with accepted professional practices as applied by similar professionals in the community at the time of this report preparation. Changes in the state of the art or in applicable regulations cannot be anticipated and have not been addressed in this report. The field and laboratory results reported herein are considered sufficient in detail and scope to determine presence of asbestos containing materials in or around the area(s) requested at the time of the inspection. Test results are valid only for the materials tested.

There is a distinct possibility that conditions may exist that could not be identified within the scope of the inspection or that were not apparent during the site visit. This inspection covered only those areas that were exposed or physically accessible to the inspector. The inspection is limited to the information available from the client at the time of the inspection was conducted.

SAMPLE RESULTS**MOBILE HOME AT, 4717 NE 372ND STREET, LA CENTER, WASHINGTON**

SAMPLE #	SAMPLE DESCRIPTION	SAMPLE LOCATION	HOMOGENEOUS AREA	ASBESTOS CONTENT
1	PINK/YELLOW INSULATION	EXTERIOR WALL	THROUGHOUT EXTERIOR WALLS AND CRAWLSPACE	NONE DETECTED
2	WHITE SPRAYED ON CEILING TEXTURE	KITCHEN	LIVING ROOM, HALLWAY	NONE DETECTED
3	WHITE SPRAYED ON CEILING TEXTURE	LIVING ROOM	KITCHEN, HALLWAY	NONE DETECTED
4	WHITE SPRAYED ON CEILING TEXTURE	HALLWAY	KITCHEN, LIVING ROOM	NONE DETECTED
5	YELLOW PARQUET FLOORING MASTIC	KITCHEN FLOOR		NONE DETECTED
6	WHITE CERAMIC TILE WITH GROUT	AS COUNTERTOP KITCHEN		NONE DETECTED
7	WHITE GYPSUM WALLBOARD WITH TAPE AND MUD	KITCHEN	SELECTIVE THROUGHOUT	NONE DETECTED
8	WHITE GYPSUM WALLBOARD WITH TAPE AND MUD	BEDROOM	SELECTIVE THROUGHOUT	NONE DETECTED
9	WHITE GYPSUM WALLBOARD WITH TAPE AND MUD	LIVING ROOM	SELECTIVE THROUGHOUT	NONE DETECTED
10	WHITE GYPSUM WALLBOARD WITH TAPE AND MUD	MASTER BEDROOM	SELECTIVE THROUGHOUT	NONE DETECTED
11	WHITE GYPSUM WALLBOARD WITH TAPE AND MUD	MASTER BATHROOM	SELECTIVE THROUGHOUT	NONE DETECTED
12	WHITE GYPSUM WALLBOARD WITH TAPE AND MUD	HALLWAY	SELECTIVE THROUGHOUT	NONE DETECTED
13	WHITE WALL TEXTURE	LIVING ROOM	BATHROOM, MASTER BEDROOM, MASTER BATHROOM	NONE DETECTED
14	WHITE WALL TEXTURE	MASTER BEDROOM	BATHROOM, LIVING ROOM, MASTER BATHROOM	NONE DETECTED
15	WHITE WALL TEXTURE	MASTER BATHROOM	BATHROOM, LIVING ROOM, MASTER BEDROOM	NONE DETECTED
16	WHITE CEILING TEXTURE	MASTER BATHROOM		NONE DETECTED

SAMPLE RESULTS**MOBILE HOME AT, 4717 NE 372ND STREET, LA CENTER, WASHINGTON**

SAMPLE #	SAMPLE DESCRIPTION	SAMPLE LOCATION	HOMOGENEOUS AREA	ASBESTOS CONTENT
17	WHITE CEILING TEXTURE	MASTER BATHROOM		NONE DETECTED
18	WHITE CEILING TEXTURE	MASTER BATHROOM		NONE DETECTED
19	YELLOW SHEET VINYL	AS PATCH KITCHEN		NONE DETECTED
20	BROWN SHEET VINYL	BATHROOM	BEDROOM CLOSET ADJACENT KITCHEN	NONE DETECTED
21	WHITE COVE BASE MASTIC	BATHROOM		NONE DETECTED
22	WHITE SHOWER SURROUND AND MASTIC	BATHROOM	MASTER BATHROOM	NONE DETECTED
23	MULTI COLORED FLOOR TILE AND MASTIC	UNDER WOOD FLOOR LAUNDRY ROOM		NONE DETECTED
24	WHITE COUNTERTOP MATERIAL AND MASTIC	LAUNDRY ROOM	MASTER BATHROOM	NONE DETECTED
25	BLUE/WHITE SHEET VINYL	UNDER WOOD FLOOR LAUNDRY ROOM		NONE DETECTED
26	BROWN/GRAY FLOOR TILE AND MASTIC	BACK STORAGE ROOM		NONE DETECTED
27	BROWN SHEET VINYL	MASTER BATHROOM		NONE DETECTED
28	BLACK ASPHALT SHINGLE	TOP LAYER ROOF	ENTIRE ROOF	NONE DETECTED
29	BLACK ASPHALT SHINGLE	SECOND LAYER ROOF	ENTIRE ROOF	NONE DETECTED
30	BLACK TAR PAPER	BOTTOM LAYER ROOF	ENTIRE ROOF	NONE DETECTED
31	GRAY GROUT	FIREPLACE		NONE DETECTED

ASSESSMENT OF MATERIALS**Building: MOBILE HOME AT, 4717 NE 372ND STREET, LA CENTER, WASHINGTON**

Sample #s	Functional Space	Asbestos Type	%	Material And Condition	Comments	Sq. Ft. And/or Linear Footage
	ASBESTOS WAS NOT IDENTIFIED IN THIS LOCATION					

Please note: the quantities and/or amounts listed within (Summary Data, Assessment of Materials sections) are estimates only and are not to be relied upon for estimating the removal costs. All quantities and/or amounts should be field verified by the responsible parties for the true amounts and removal costs.

Inspector: Kyler Spears- Accreditation Number: 183459**Signature:****Date:** November 22, 2023

RESPONSE ACTIONS RECOMMENDEDBuilding: **MOBILE HOME AT, 4717 NE 372ND STREET, LA CENTER, WASHINGTON**

MATERIAL	LOCATION	RECOMMENDED RESPONSE ACTIONS
ASBESTOS WAS NOT IDENTIFIED IN THIS LOCATION		

Management Planner: Don Young - Accreditation Number: 190128**Signature:** _____**Date** November 22, 2023

SAMPLE ANALYSIS REPORT**CLIENT:** MR. PAUL MUIRHEADPO BOX 530
LA CENTER, WASHINGTON 98629**SOURCE:** MOBILE HOME AT, 4717 NE 372ND STREET,
LA CENTER, WASHINGTON**SAMPLED BY:** KYLER SPEARS/ERIC S. VIKEN**LAB/JOB #:** 11-1278/23-255**ANALYZED BY:** KYLER SPEARS**DATE SAMPLED:** 11-17-23**DATE RECEIVED:** 11-17-23**DATE COMPLETED:** 11-20-23ANALYTICAL METHOD: EPA 600/R-93/116, 40 CFR Part 763, Subpart E, Appendix E, Section 1,
PLM/Dispersion Staining

SAMPLE ID #	SAMPLE DESCRIPTION	SAMPLE LOCATION	ASBESTOS CONTENT	OTHER MATERIAL
1	PINK/YELLOW INSULATION	EXTERIOR WALL	NONE DETECTED	80% FIBERGLASS, DEBRIS
2	WHITE SPRAYED ON CEILING TEXTURE	KITCHEN	NONE DETECTED	3% CELLULOSE, CALCIUM CARBONATE, SYNTHETIC FOAM, BINDER
3	WHITE SPRAYED ON CEILING TEXTURE	LIVING ROOM	NONE DETECTED	3% CELLULOSE, CALCIUM CARBONATE, SYNTHETIC FOAM, BINDER
4	WHITE SPRAYED ON CEILING TEXTURE	HALLWAY	NONE DETECTED	3% CELLULOSE, CALCIUM CARBONATE, SYNTHETIC FOAM, BINDER
5	YELLOW PARQUET FLOORING MASTIC	KITCHEN FLOOR	NONE DETECTED	10% CELLULOSE, CALCIUM CARBONATE, BINDER, CLAY, ADHESIVE
6	WHITE CERAMIC TILE WITH GROUT	AS COUNTERTOP KITCHEN	NONE DETECTED	CLAY, SAND, CEMENT, CERAMIC
7	WHITE GYPSUM WALLBOARD WITH TAPE AND MUD	KITCHEN	NONE DETECTED	10% CELLULOSE, 5% FIBERGLASS, CALCIUM SULFATE, CALCIUM CARBONATE, BINDER
8	WHITE GYPSUM WALLBOARD WITH TAPE AND MUD	BEDROOM	NONE DETECTED	10% CELLULOSE, 5% FIBERGLASS, CALCIUM SULFATE, CALCIUM CARBONATE, BINDER

ANALYST:

DEVIATION FROM METHOD: NONE.

PERCENTAGES ARE ESTIMATES.

TEST RESULTS PERTAIN ONLY TO ITEMS TESTED.

* DETECTION LIMIT IS LESS THAN 1% ASBESTOS.

NON-ASBESTOS MATERIALS ARE NOT NECESSARILY LISTED.

REVIEWED BY:

SAMPLE ANALYSIS REPORT**CLIENT:** MR. PAUL MUIRHEADPO BOX 530
LA CENTER, WASHINGTON 98629**SOURCE:** MOBILE HOME AT, 4717 NE 372ND STREET,
LA CENTER, WASHINGTON**SAMPLED BY:** KYLER SPEARS/ERIC S. VIKEN**LAB/JOB #:** II-1278/23-255**ANALYZED BY:** KYLER SPEARS**DATE SAMPLED:** 11-17-23**DATE RECEIVED:** 11-17-23**DATE COMPLETED:** 11-20-23ANALYTICAL METHOD: EPA 600/R-93/116, 40 CFR Part 763, Subpart E, Appendix E, Section 1,
PLM/Dispersion Staining

SAMPLE ID #	SAMPLE DESCRIPTION	SAMPLE LOCATION	ASBESTOS CONTENT	OTHER MATERIAL
9	WHITE GYPSUM WALLBOARD WITH TAPE AND MUD	LIVING ROOM	NONE DETECTED	10% CELLULOSE, 5% FIBERGLASS, CALCIUM SULFATE, CALCIUM CARBONATE, BINDER
10	WHITE GYPSUM WALLBOARD WITH TAPE AND MUD	MASTER BEDROOM	NONE DETECTED	10% CELLULOSE, 5% FIBERGLASS, CALCIUM SULFATE, CALCIUM CARBONATE, BINDER
11	WHITE GYPSUM WALLBOARD WITH TAPE AND MUD	MASTER BATHROOM	NONE DETECTED	10% CELLULOSE, 5% FIBERGLASS, CALCIUM SULFATE, CALCIUM CARBONATE, BINDER
12	WHITE GYPSUM WALLBOARD WITH TAPE AND MUD	HALLWAY	NONE DETECTED	10% CELLULOSE, 5% FIBERGLASS, CALCIUM SULFATE, CALCIUM CARBONATE, BINDER
13	WHITE WALL TEXTURE	LIVING ROOM	NONE DETECTED	3% CELLULOSE, CALCIUM CARBONATE, BINDER
14	WHITE WALL TEXTURE	MASTER BEDROOM	NONE DETECTED	3% CELLULOSE, CALCIUM CARBONATE, BINDER
15	WHITE WALL TEXTURE	MASTER BATHROOM	NONE DETECTED	3% CELLULOSE, CALCIUM CARBONATE, BINDER
16	WHITE CEILING TEXTURE	MASTER BATHROOM	NONE DETECTED	CALCIUM CARBONATE, BINDER

ANALYST: 

DEVIATION FROM METHOD: NONE.

PERCENTAGES ARE ESTIMATES.

TEST RESULTS PERTAIN ONLY TO ITEMS TESTED.

* DETECTION LIMIT IS LESS THAN 1% ASBESTOS.

NON-ASBESTOS MATERIALS ARE NOT NECESSARILY LISTED.

REVIEWED BY: 

SAMPLE ANALYSIS REPORT**CLIENT:** MR. PAUL MUIRHEADPO BOX 530
LA CENTER, WASHINGTON 98629**SOURCE:** MOBILE HOME AT, 4717 NE 372ND STREET,
LA CENTER, WASHINGTON**SAMPLED BY:** KYLER SPEARS/ERIC S. VIKEN**LAB/JOB #:** II-1278/23-255**ANALYZED BY:** KYLER SPEARS**DATE SAMPLED:** 11-17-23**DATE RECEIVED:** 11-17-23**DATE COMPLETED:** 11-20-23ANALYTICAL METHOD: EPA 600/R-93/116, 40 CFR Part 763, Subpart E, Appendix E, Section 1,
PLM/Dispersion Staining

SAMPLE ID #	SAMPLE DESCRIPTION	SAMPLE LOCATION	ASBESTOS CONTENT	OTHER MATERIAL
17	WHITE CEILING TEXTURE	MASTER BATHROOM	NONE DETECTED	CALCIUM CARBONATE, BINDER
18	WHITE CEILING TEXTURE	MASTER BATHROOM	NONE DETECTED	CALCIUM CARBONATE, BINDER
19	YELLOW SHEET VINYL	AS PATCH KITCHEN	NONE DETECTED	20% CELLULOSE, VINYL, CALCITE, ADHESIVE
20	BROWN SHEET VINYL	BATHROOM	NONE DETECTED	20% CELLULOSE, VINYL, CALCITE, ADHESIVE
21	WHITE COVE BASE MASTIC	BATHROOM	NONE DETECTED	SILICONE CEMENT, ADHESIVE
22	WHITE SHOWER SURROUND AND MASTIC	BATHROOM	NONE DETECTED	55% FIBERGLASS, VINYL, ADHESIVE
23	MULTI COLORED FLOOR TILE AND MASTIC	UNDER WOOD FLOOR LAUNDRY ROOM	NONE DETECTED	3% CELLULOSE, CALCIUM CARBONATE, VINYL, BINDER, ADHESIVE
24	WHITE COUNTERTOP MATERIAL AND MASTIC	LAUNDRY ROOM	NONE DETECTED	55% CELLULOSE, FORMICA, VINYL, ADHESIVE

ANALYST: DEVIATION FROM METHOD: NONE.
PERCENTAGES ARE ESTIMATES.

TEST RESULTS PERTAIN ONLY TO ITEMS TESTED.

* DETECTION LIMIT IS LESS THAN 1% ASBESTOS.

NON-ASBESTOS MATERIALS ARE NOT NECESSARILY LISTED.

REVIEWED BY: 

SAMPLE ANALYSIS REPORT**CLIENT:** MR. PAUL MUIRHEADPO BOX 530
LA CENTER, WASHINGTON 98629**SOURCE:** MOBILE HOME AT, 4717 NE 372ND STREET,
LA CENTER, WASHINGTON**SAMPLED BY:** KYLER SPEARS/ERIC S. VIKEN**LAB/JOB #:** II-1278/23-255**ANALYZED BY:** KYLER SPEARS**DATE SAMPLED:** 11-17-23**DATE RECEIVED:** 11-17-23**DATE COMPLETED:** 11-20-23ANALYTICAL METHOD: EPA 600/R-93/116, 40 CFR Part 763, Subpart E, Appendix E, Section 1,
PLM/Dispersion Staining

SAMPLE ID #	SAMPLE DESCRIPTION	SAMPLE LOCATION	ASBESTOS CONTENT	OTHER MATERIAL
25	BLUE/WHITE SHEET VINYL	UNDER WOOD FLOOR LAUNDRY ROOM	NONE DETECTED	20% CELLULOSE, VINYL, CALCITE, ADHESIVE
26	BROWN/GRAY FLOOR TILE AND MASTIC	BACK STORAGE ROOM	NONE DETECTED	CALCIUM CARBONATE, VINYL, BINDER, ADHESIVE, CLAY
27	BROWN SHEET VINYL	MASTER BATHROOM	NONE DETECTED	10% CELLULOSE, SYNTHETIC FOAM, VINYL, CALCITE
28	BLACK ASPHALT SHINGLE	TOP LAYER ROOF	NONE DETECTED	30% FIBERGLASS, TAR, AGGREGATE
29	BLACK ASPHALT SHINGLE	SECOND LAYER ROOF	NONE DETECTED	30% FIBERGLASS, TAR, AGGREGATE
30	BLACK TAR PAPER	BOTTOM LAYER ROOF	NONE DETECTED	65% CELLULOSE, TAR
31	GRAY GROUT	FIREPLACE	NONE DETECTED	AGGREGATE, CEMENT

ANALYST:

DEVIATION FROM METHOD: NONE.

PERCENTAGES ARE ESTIMATES.

TEST RESULTS PERTAIN ONLY TO ITEMS TESTED.

* DETECTION LIMIT IS LESS THAN 1% ASBESTOS.

NON-ASBESTOS MATERIALS ARE NOT NECESSARILY LISTED.

REVIEWED BY:

Certificate of Completion

This is to certify that
Kyler J.M. Spears
has satisfactorily completed
4 hours of online refresher training as an
AHERA Building Inspector
to comply with the training requirements of
TSCA Title II, 40 CFR 763 (AHERA)

EPA Provider # 1085

187341
Certificate Number


Instructor: Andre Zwanenburg

Jan 5, 2023 Expires in 1 year.

Date(s) of Training

Exam Score: N/A
(If applicable)



- Facilities
- Environmental
- Geotechnical
- Materials

TERRACON TRAINING - FORMERLY ARGUS PACIFIC / 21905 64TH AVE W, SUITE 100, / MOUNTLAKE TERRACE, WASHINGTON 98043 / 206.285.3373 / ARGUSPACIFIC.COM

OK

Certificate of Completion

This is to certify that
Don E. Young
has satisfactorily completed
4 hours of online refresher training as an
AHERA Building Inspector
to comply with the training requirements of
TSCA Title II, 40 CFR 763 (AHERA)
EPA Provider # 1085

190124
Certificate Number


Instructor: David Welch



- Facilities
- Environmental
- Geotechnical
- Materials

Jul 13, 2023 Expires in 1 year
Date(s) of Training
Exam Score: N/A
(if applicable)

TERRACON TRAINING - FORMERLY ARGUS PACIFIC / 21905 64TH AVE W, SUITE 100 / MOUNTLAKE TERRACE, WASHINGTON 98043 / 206.285.3373 / ARGUSPACIFIC.COM

Certificate of Completion

This is to certify that
Don E. Young
has satisfactorily completed
4 hours of refresher training as an
AHERA Management Planner
to comply with the training requirements of
TSCA Title II, 40 CFR 763 (AHERA)
EPA Provider # 1085

190128
Certificate Number


Instructor: David Welch



- Facilities
- Environmental
- Geotechnical
- Materials

Jul 13, 2023 Expires in 1 year
Date(s) of Training
Exam Score: N/A
(if applicable)

TERRACON TRAINING - FORMERLY ARGUS PACIFIC / 21905 64TH AVE W, SUITE 100 / MOUNTLAKE TERRACE, WASHINGTON 98043 / 206.285.3373 / ARGUSPACIFIC.COM

Certificate of Completion

This is to certify that
Eric S. Viken
has satisfactorily completed
4 hours of online refresher training as an
AHERA Building Inspector
to comply with the training requirements of
TSCA Title II, 40 CFR 763 (AHERA)

EPA Provider # 1085

187343
Certificate Number


Instructor: Andre Zwanenburg

Jan 5, 2023 Expires in 1 year.

Date(s) of Training

Exam Score: N/A
(if applicable)



- Facilities
- Environmental
- Geotechnical
- Materials

TERRACON TRAINING - FORMERLY ARGUS PACIFIC / 21905 64TH AVE W, SUITE 100 / MOUNTLAKE TERRACE, WASHINGTON 98043 / 206 285.1373 / ARGUSPACIFIC.COM

OK

PHOTOGRAPHIC LOG

ORIGINAL












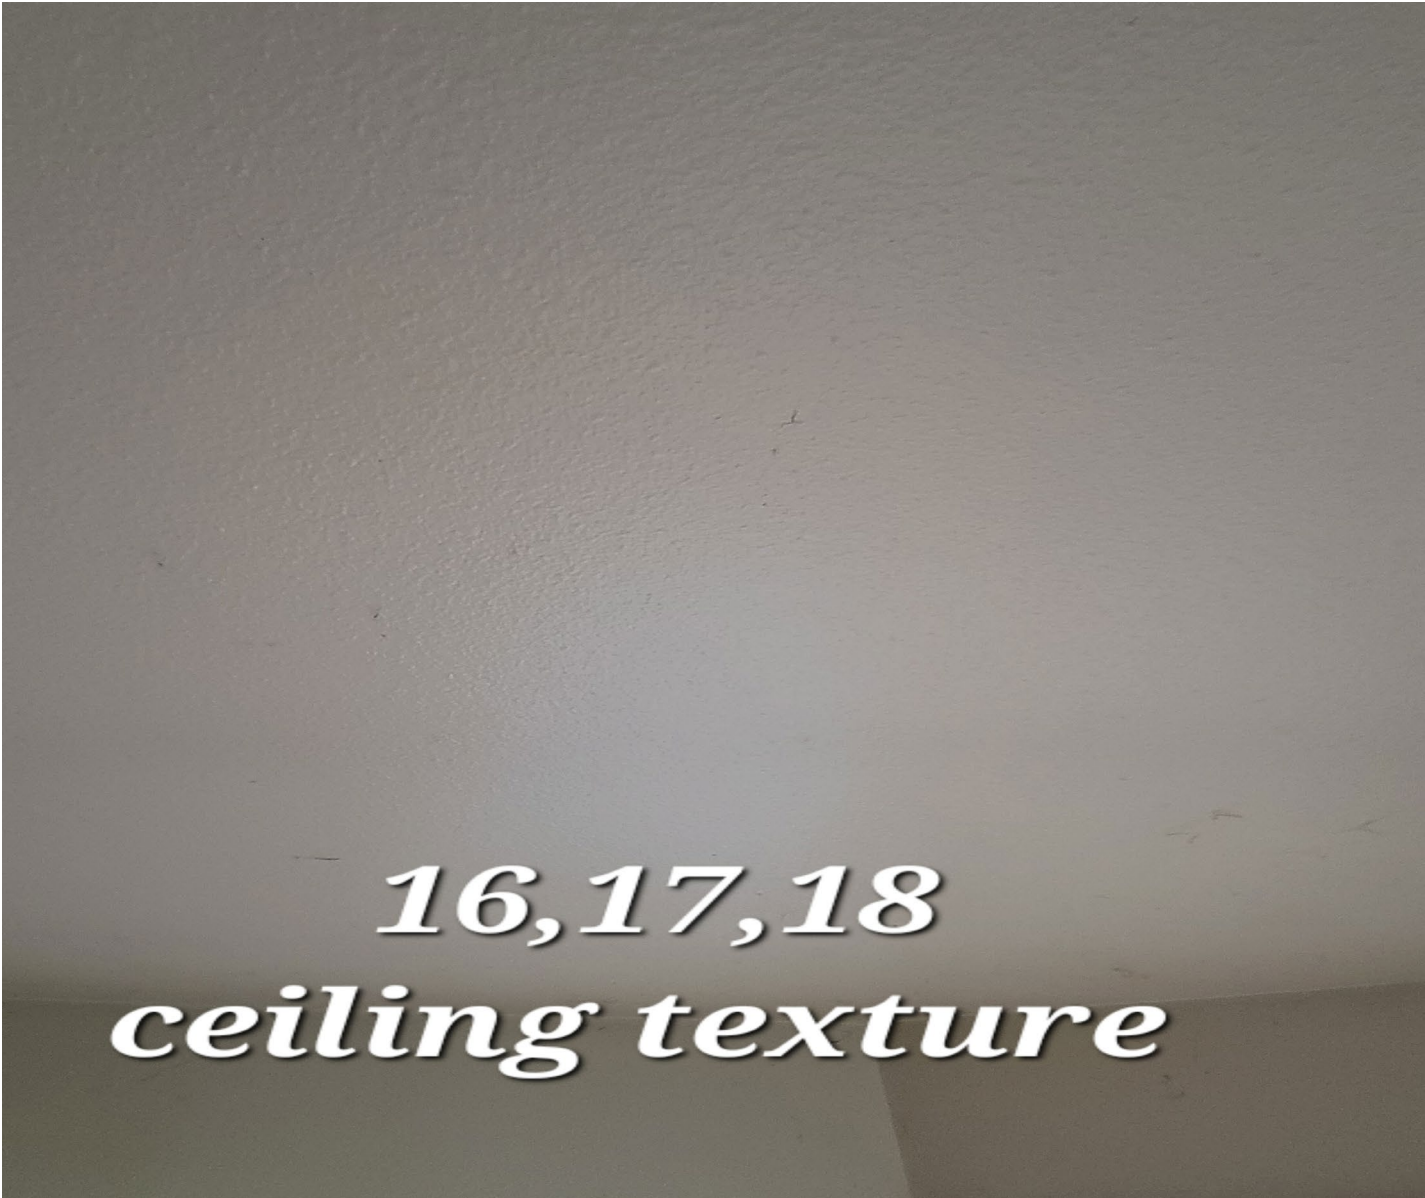






*7,8,9
10,11,12
gypsum wallboard
w/ tape & mud
13,14,15
wall texture*

A photograph of a wall, likely made of gypsum wallboard, showing a bright light source from the left that creates a strong glare and a dark shadow on the right side. The wall has a slightly textured appearance. The text is overlaid on the left side of the image.



*16,17,18
ceiling texture*





















CERTIFIED ENVIRONMENTAL CONSULTING, LLC.

23-255

SURVEY REPORT

LAB # II-1278

DATE: 1177 SAMPLED BY: KS/ERN COST/QUOTE \$ _____ PO#/JOB # _____

CLIENT: Paul Airhead CONTACT: _____

BILLING ADDRESS: _____ CITY/STATE: _____ ZIP: _____

PHONE: _____ CELL: Mobile Home EMAIL/FAX: _____

PROJECT ADDRESS: 4717 ne 372 st Laconia, Washington

YEAR BUILT: 1989 TOTAL SF: 1200 CONSTRUCTION TYPE wood, metal

HOW MANY FLOORS: 1 BASEMENT PRESENT: NO

ROOFING TYPE: AS BUILDING USE PREVIOUS/CURRENT: Resi

HEATING SYSTEM: Furnace INSULATION: ATTIC: FF PIPES: None

SAMPLE #	DESCRIPTION OF MATERIAL	SAMPLE LOCATION	HOMOGENEOUS AREA	SQ FOOTAGE
1	Insulation pink/yellow	ext wall/	T/O ext walls & crawspace	
2	spot white	Kitchen	Living Room Hallway	900
3	spot white	LVR	Kitchen Hallway	
4	spot white	hallway	Kitchen Living Room	
5	parquet maple yellow	Kitchen Floor		100
6	ceramic tile white	Kitchen counter top		40
7	GWB™ white	Kitchen	STO	
8	GWB™ white	Bedroom	STO	
9	GWB™ white	LVR	STO	

❖ CERTIFIED ENVIRONMENTAL CONSULTING, LLC. ❖

615 SE CHKALOV DRIVE SUITE 12, VANCOUVER, WASHINGTON 98683-5280
(503) 221-7904 PHONE (360) 254-9385 AND FAX-(360) 891-9633

SURVEY SAMPLE FORM

LAB # II-1278

SAMPLE #	DESCRIPTION OF MATERIAL	SAMPLE LOCATION	HOMOGENEOUS AREA	SQ FOOTAGE
10	Ceiling T _m white	master Bedroom	STO	
11	Ceiling T _m white	master Bathroom	STO	
12	Ceiling T _m white	hallway	STO	
13	wall t _m white	LVR	Bathroom, master Bedroom, master Bathroom	600
14	wall t _m white	Master Bedroom	Bathroom, Living Room, master Bathroom	
15	wall t _m white	Master Bathroom	Bathroom, Living Room, master Bedroom	
16	ceiling t _m white	Master Bathroom		400
17	ceiling t _m white	master Bathroom		
18	ceiling t _m white	Master Bathroom		
19	Shur yellow	As patch Kitchen		20
20	Brown sheet vinyl	Bathroom	Bedroom, closet, Kitchen	60
21	white CB m	Bathroom		20
22	white shower surround & master	Bathroom	Master Bathroom	2
23	Multi colored P _t m	under wood floor laundry room		100
24	white counter top material & m	laundry room	Master Bathroom	700

[illegible]